





Fig.2

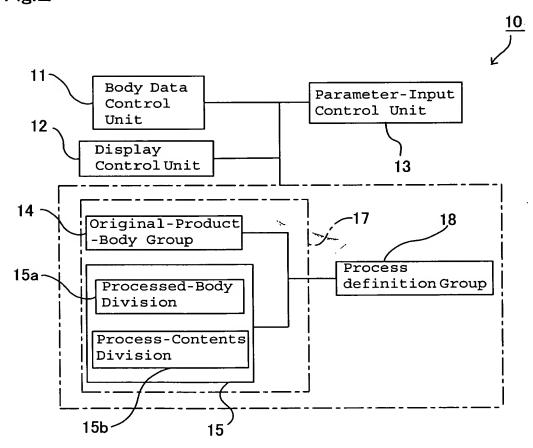

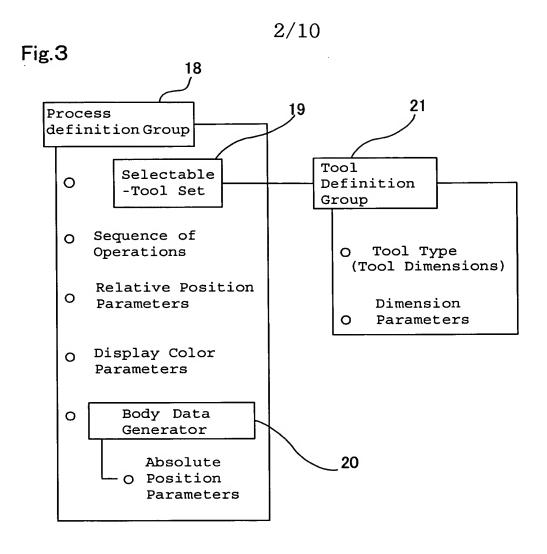


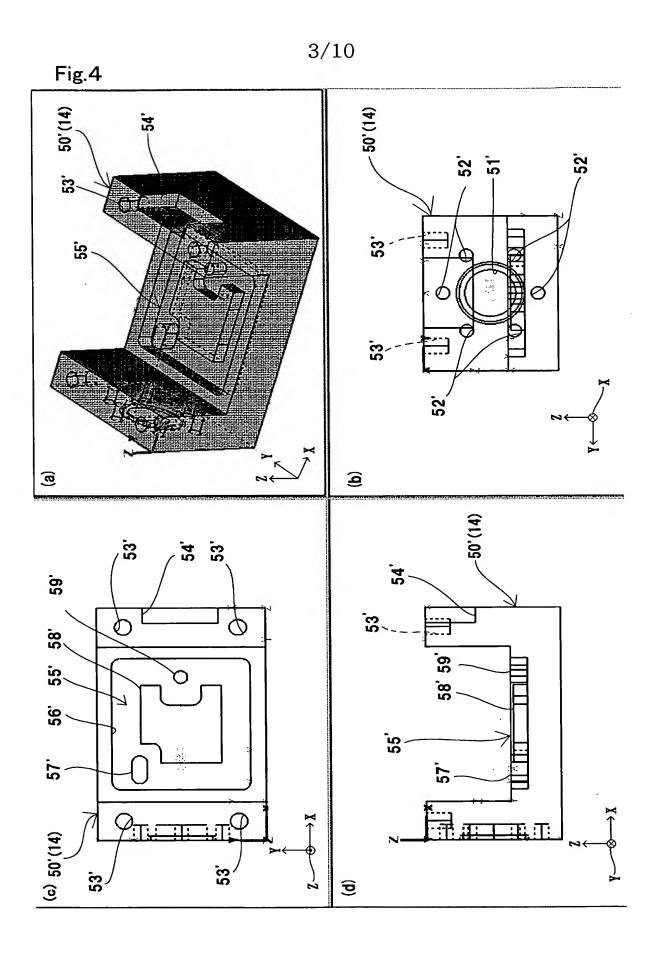


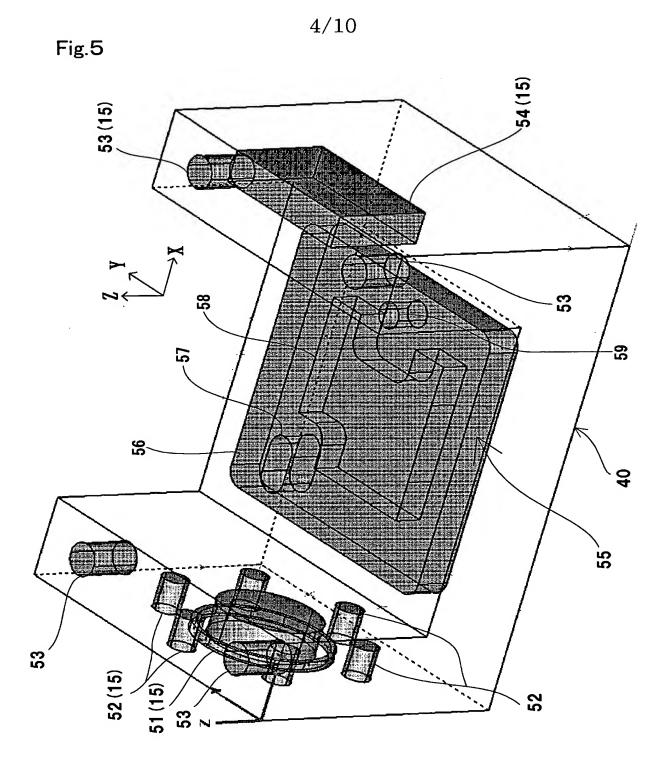

5/10

Fig.6

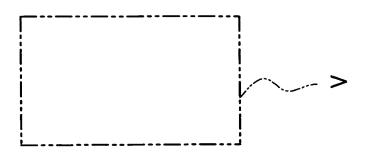

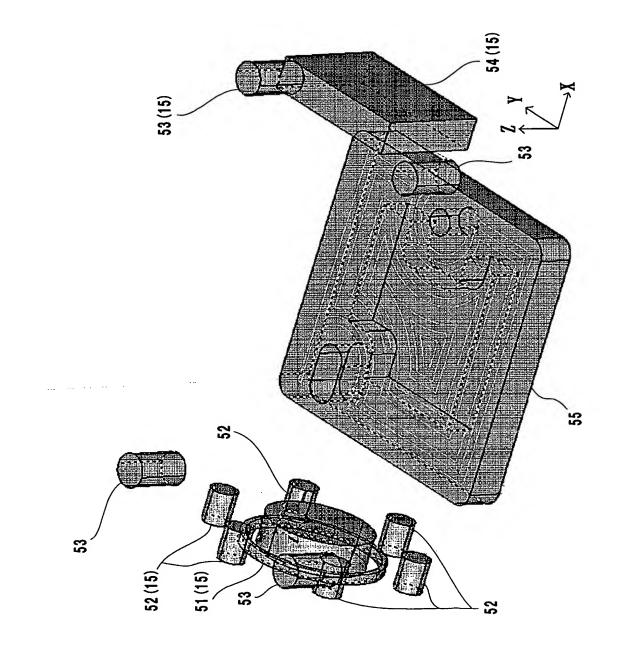

6/10

Fig.7

_				\	70	
Tool List						
No 1 2 3 4 5 6 7 8 9 10 11 12 13 14 15	Tool Name Center drill Center drill Center drill Center drill Drill (High speed) Mill drill rough-mil rough-mil rough-mil rough-mil	10,0	00 00 00 00 00 00 00 00 00 00 00	Surface 0 0 2 2 2 2 0 0 0 2 0 0 0 0		
Tool Surface Machin- ▲ ▼ Delete Register						gister
	Type of machining		Pocket making			
	Sub Number		0			
	Step Relief		50,000 50,000			
	Machining Depth		1,667			
	Approach speed		100,000			
	Cutting speed		100,000			
	Offset direction		Left ▼			
User definition [Keep display Display tools						




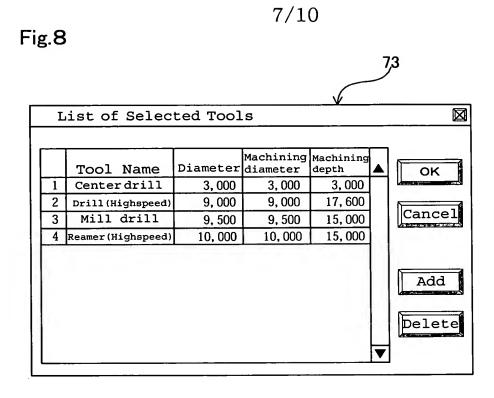


Fig.9



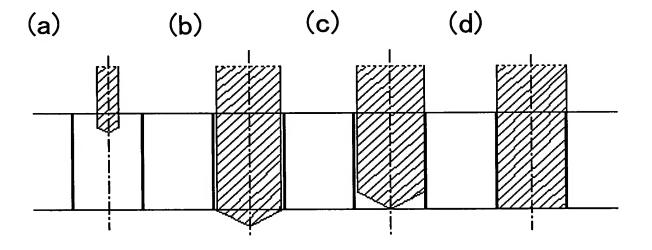


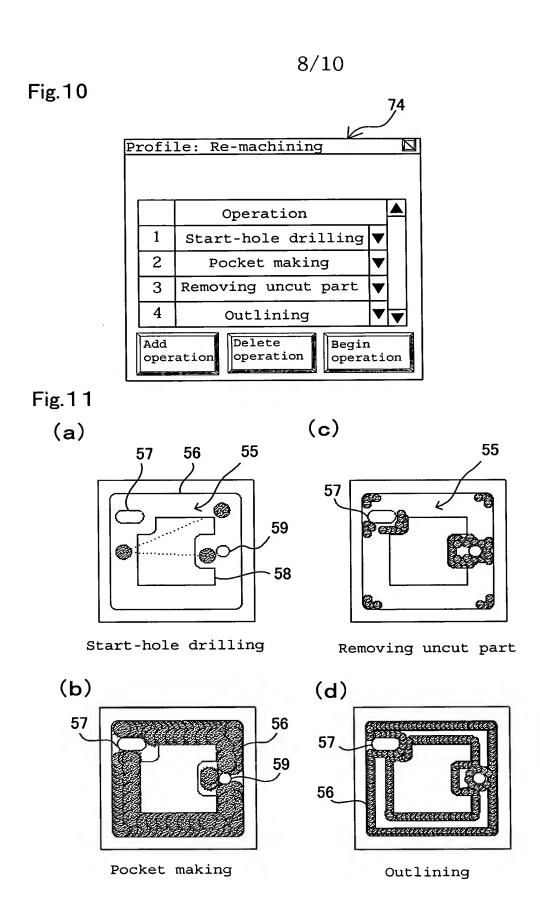

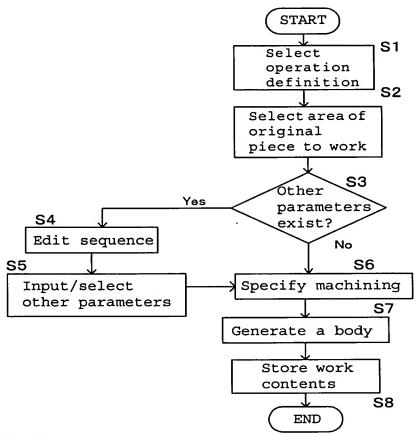

9/10

Fig. 13

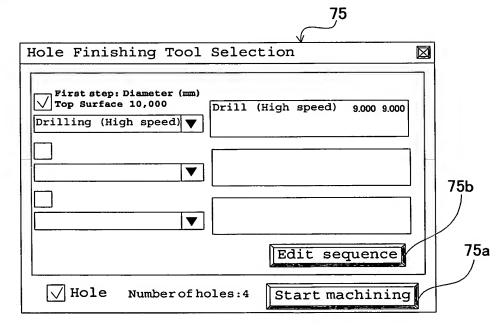



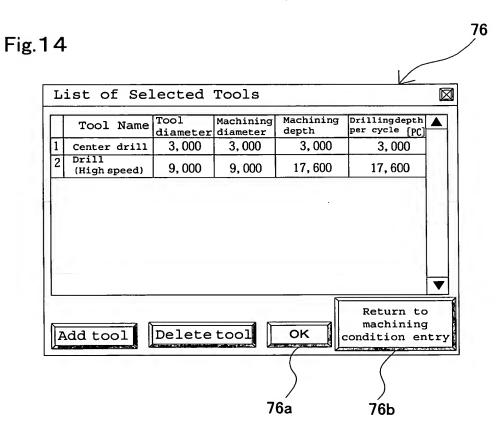


Fig. 15

